 


CABLE ASSEMBLY INSTRUCTIONS

 
RFE-6050-C

MAIN BODY




FERRULE STUD

BACK NUT




CONTACT

 


CRIMP FERRULE




STEP 1

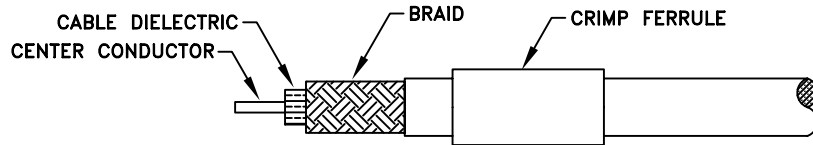


STEP 2

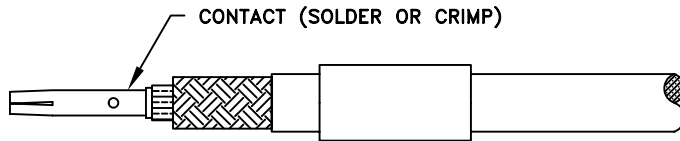

STEP 3

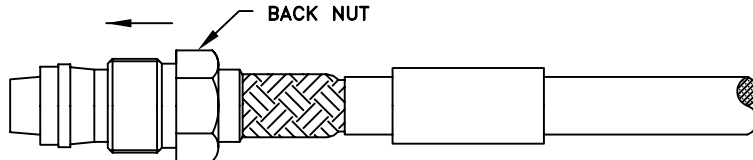

STEP 4

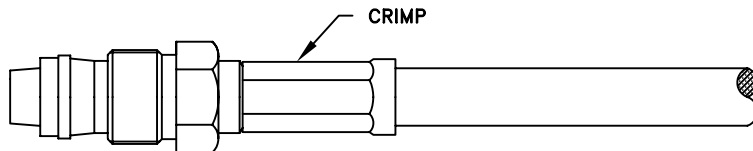

- Step 1: Cut end of cable evenly. Strip cable to dimensions shown in catalog or on outline drawing. All cuts are to be clean and square. Do not nick braid or center conductor when cutting. Slide ferrule over cable. If using strain relief or heat shrink tubing slide onto cable first.
- Step 2: Pre tin cable conductor if using stranded cable (if needed). Slide contact onto center conductor until it yields against the cable dielectric. Crimp or solder contact in place.
- Step 3: Slide "back nut" over main connector. Slide ferrule stud under braid, while inserting the contact into the body.
- Step 4: Slide the ferrule over the braid until it yields against the back of the connector. Crimp the ferrule with crimp tool as specified on connector drawing. Trim any extra braid extending out of ferrule end.

RFE-6050-C AP.DWG

RF CONNECTORS

7/11/07

7610 Miramar Road, San Diego, CA 92126-4202 - (858) 549-6340
(800) 233-1728 - Fax (858) 549-6345 E-mail: rfi@rfindustries.com - www.rfindustries.com

CZ