



# CABLE ASSEMBLY INSTRUCTIONS


RFB-1101-1X

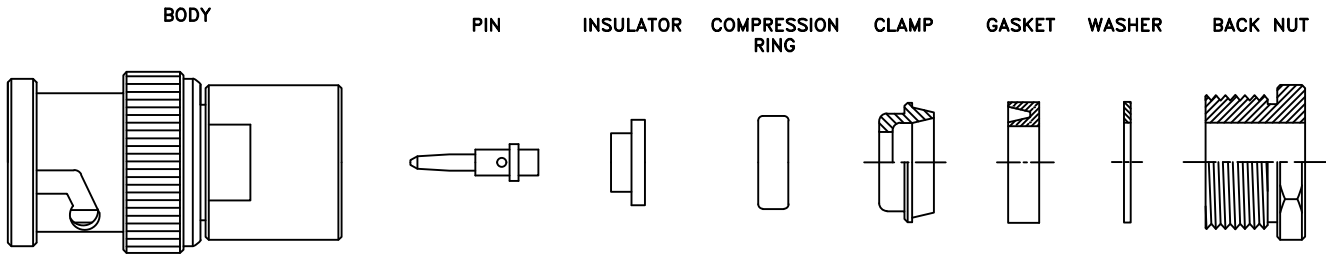


STEP 1

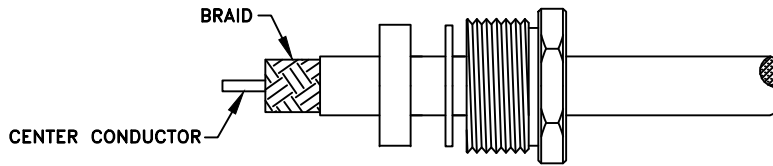


STEP 2

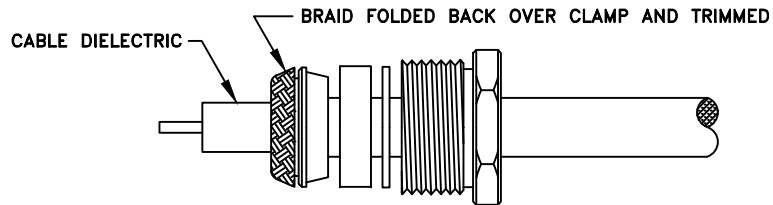

STEP 3

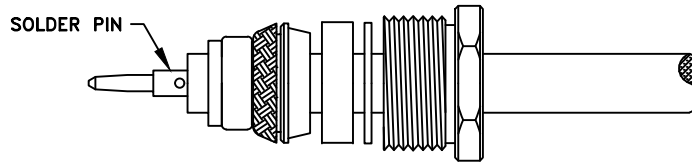

STEP 4

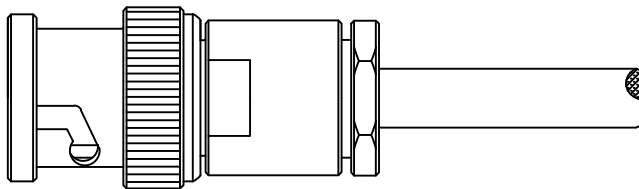

- Step 1: Cut end of cable evenly. Strip cable to dimensions shown on outline drawing. All cuts are to be clean and square. Do not nick braid, dielectric or center conductor. Slide back nut, washer and gasket onto cable. Braid must be combed for assembly of clamp.
- Step 2: Place the clamp over braid and push clamp back against cable jacket. Fold back braid wire and form over the clamp evenly. Trim extra braid if needed.
- Step 3: Slide compression ring and insulator over cable and push them against cable braid. Place pin onto center conductor until it yields against the cable dielectric. Pre tin cable conductor if using stranded cable (if needed). Solder pin in place using minimum amount of heat.
- Step 4: Snug gasket against the clamp. Insert pin, cable and hardware into the body. Tighten back nut while holding body stationary.

*RF CONNECTORS*

7610 Miramar Road, San Diego, CA 92126-4202 - (858) 549-6340  
 (800) 233-1728 - Fax (858) 549-6345 E-mail: rfi@rfindustries.com - www.rfindustries.com

RFB-1101-1X AP.DWG  
 11/18/18  
 CZ